

2015 Pro Angler skeg line reroute

Video available at <http://www.hobiecat.com/skeg-line/>

Tools needed:

- ① #2 phillips screwdriver
- ② #3 phillips screwdriver
- ③ Drill
- ④ 5/16" drill bit
- ⑤ Needle nose pliers
- ⑥ 7/16" wrench
- ⑦ 2nd 7/16" wrench or socket
- ⑧ 1/2" wrench
- ⑨ Lighter[optional]

84610122 PA SKEG LINE KIT:


Tubing and grommet

5/16" panel rivet

- ① Remove the 4 screws from the steering cover plate.



- ② If the skieg line exits the hull at the front of the steering box, continue with this upgrade. If the skieg line comes from the side, you do not need to do this.

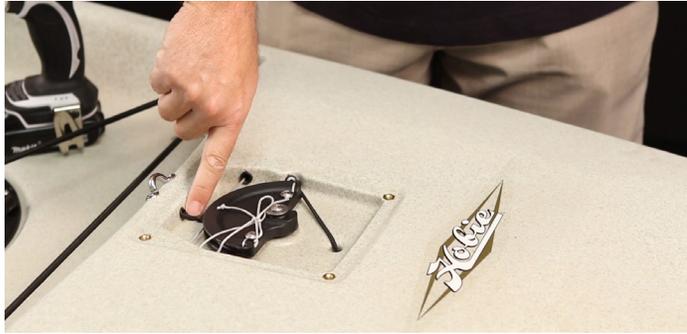

- ③ Turn your boat on its side or upside down and remove the 4 screws from the skieg housing.



- ④ Release the skieg line from the cleat. Without removing the skieg from the housing, remove the screw and bolt from the pulley and pivot. Untie and remove the line.



- ⑤ Using the 5/16" bit, drill a hole halfway between the steering line and front of the steering box.



- ⑥ Reach inside the rear hatch and pull the skieg line out. Reroute the skieg line through the new hole ensuring that the line goes above the steering lines that criss cross at the back of the tankwell.



- ⑦ Feed the line through tube and grommet from the kit. You may need to burn the end of the line to help feed it through. Remove the old grommet and install the panel rivet. Pass skieg line through scupper hole.



2015 Pro Angler skeg line reroute

- ⑧ Pass the line through the hole in the skeg so it goes toward the hole on the side of the housing. Pass the line through the hole in the side of the housing.



- ⑨ Tie a figure 8 knot to prevent the line from backing out.



- ⑩ Reinstall the pulley and screw ensuring that the line is between the pulley and the housing. Do not overtighten, the pulley should spin freely.



- ⑪ Install the pivot bolt. Do not overtighten, the skeg should move freely.



- ⑫ Reinstall the skeg housing using the 4 screws.



- ⑬ With the boat upright and the rear of the boat raised off the ground, test the function of the skeg. If it functions properly, reinstall steering cover.

